


Terminologia czujników światłowodowych

**na podstawie Guideline for Use of Fibre
Optics Sensors SG3/WG4 COST 299 FIDES
Wolfgang Habel i inii.**

FOS Przewodnik

- 1. Wprowadzenie**
- 2. Parametry ogólne**
- 3. Funkcjonalność**
- 4. Charakterystyki odpowiedzi**
- 5. Wielkości o charakterze losowym**
- 6. Warunki bezpieczeństwa optycznego**
- 7. Literatura**



2. Parametry ogólne

Kategoria ta opisuje parametry wszystkich lub prawie wszystkich FOS

- **Type of used fibre**
- **Type of sensor**
- **Distance range**
- **Measurement range**
- **Wavelength of operation**
 - **characteristic wavelength @ reference temperature (FBGs)**
- **Gauge factor / scale factor @ reference conditions**
- **True value**

Type of used fibre (typ wykorzystanego włókna)

It is a known category of fibre used for FOS construction. If FOS is affected using a specific type of fibre, this must be indicated.

Type of the sensor (typ czujnika)

It is physical base of sensor operation as: a distributed sensor (which is sensitive over the whole fibre length), point sensor (which is represented by a discrete (single) sensitive element or a chain/number of sensitive elements).

Distance range (zakres długości)

It is the fibre length over which the measurement can be performed within the stated uncertainty and spatial resolution.

Note: For attenuation-limited systems it can be calculated as follows: Distance range [km] = (Optical budget [dB] - connection loss [dB]) / Linear attenuation of fibre [dB/km]

Measurement range (zakres pomiaru)


It is defined by the minimum and maximum allowable values of the measurand.

Note: It may be limited by several factors, e.g. onset of unacceptable non-linearities, mechanical issues, etc.

Wavelength of operation (długość fali działania)

It is the wavelength (range of wavelengths) of optical radiation which the sensor users in order to provide the required information.

Characteristic wavelength @ reference temperature (FBGs): It is the wavelength that characterizes the sensor response at reference temperature monitored by the interrogator. It shall be given together with the experimental and numerical method used for its determination.

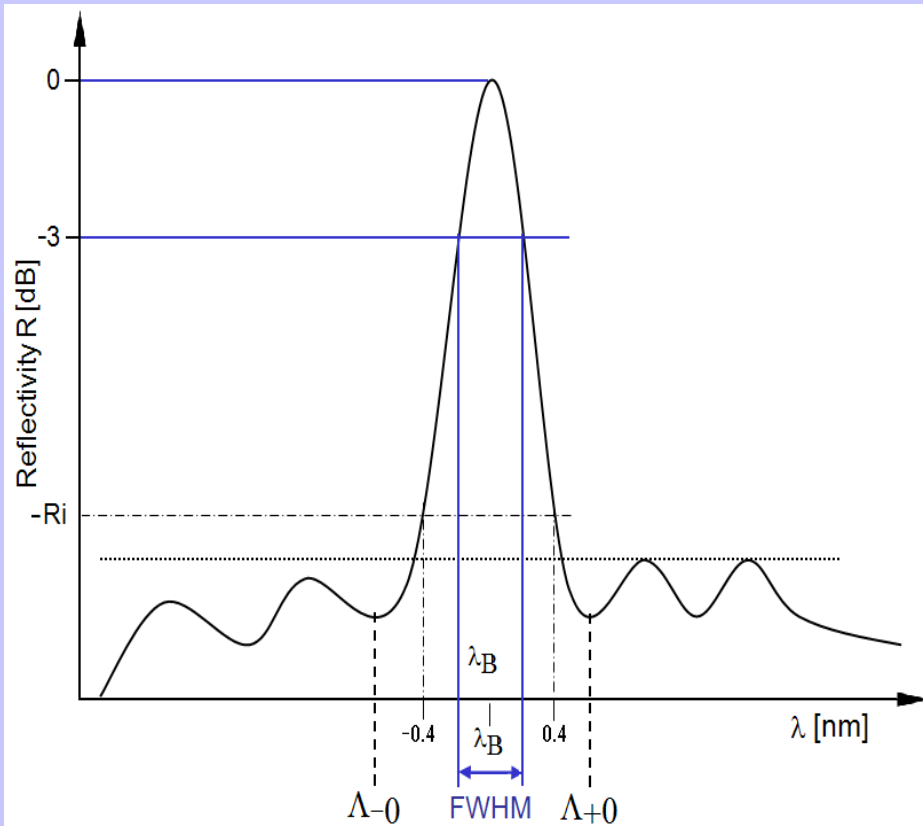

Note: The characteristic wavelength can be measured as the maximum value of the peak in reflection or as minimum value of the transmission spectra.

Important characteristics of FBG for sensors:

- Peak wavelength [nm];
- Peak wavelength deviation at room temperature [nm];
- Peak reflectivity [%];
- FWHM peak width (-3-dB band-width) [nm];
- Side lobe sup-pression at $\pm 0,4$ nm [$> xx$ dB];
- $\Lambda+0$, $\Lambda-0$ (first poles (minima) of the Bragg grating reflection peak);
- Pulse stability (Side lobe suppression);
- Reflectivity above the amount R_i with a typical spectral width of more than ± 0.4 nm around the Bragg wavelength. For this width no additional peaks (side lobes) are expected.

Gauge factor / scale factor @ reference conditions (współczynnik pomiaru/skali @ warunki odniesienia))


It is specification how the input quantity of a measurement device is changed into the output quantity.

Note: Sometimes the term strain factor or K factor is used whereas then a linear characteristic has to be assumed. The gauge factor can separately be defined for the components of a measurement system. It is only valid for defined conditions. In case of non-linear characteristic, the gauge factor can be linearized within defined amount of permissible error. Reference condition include values and ranges for the influence quantities affecting the measurement system.

True value (wartość rzeczywista)

It is the result of a measurement that would be obtained by a perfect measurement.

Note: Because true values are by nature indeterminate, there may be many values consistent with the definition of a given particular quantity. A number of results of measurements enables to establish best estimate for the true value with the minimum uncertainty. This estimate is called conventional true value, assigned value, sometimes reference value. The conventional true value can have an uncertainty appropriate for a given purpose which is generally accepted by convention. The expression "reference value" in this sense should not be confused with the term reference value referred to reference conditions that are prescribed for performance tests or for intercomparison of results of measurements.



3. Funkcjonalność

Kategoria parametrów opisujących użyteczność FOS podczas pracy

- **Fatigue**
- **Life expectancy / lifetime**
- **Durability**
- **Failure criteria**
- **Gauge length**
- **Sampling interval**
- **Optical power dynamic range**
- **Warm-up time**
- **Measuring time**
- **Updating time**
- **Limiting conditions**

Fatigue (zmęczenie)

It is a change of the result due to accumulation of mechanical damage.

Note: It can be influence by the method of sensor attachment to the measured object and materials used.

Life expectancy / lifetime (prognoza żywotności/ żywotność)

It is a period of time during which the measuring system or its components are operating according to all its specifications in given conditions.

Note: In this time the system will perform its internal function, satisfactorily or without failure, e.g. within specified performance limits, when used in the manner and for the purpose intended, while operating under the specified application and operation environments with their associated stress levels..

Durability (trwałość)

It is related to the quality of a manufactured component of a measurement system or of the whole measurement system and indicates how well it withstands a sustained period of specified operation. It comprises the degree to which the system or its components can withstand physical, chemical, or environmental factors.

Note: A durable item can be used over a definite, mostly long period without being degraded or consumed.

Failure criteria (warunki uszkodzenia)


It is the measurement uncertainty (overstress, overheating, etc.) which exceeds the specified level or no results are provided.

Note: A component is considered faulty if it no longer meets applicable mandatory requirements listed in the data sheet.

Gauge length (odległość wskazań)

It is the length of the measured object over which the sensor gathers information. For example, if the sensor is only anchored at two fixed points L cm apart, then the GL is L . On the other hand, if a sensor of length l is continuously-fixed in or to a measured object of length L , then the actual GL depends on the method of attachment to the measured object and is a function of the mechanical properties of both the sensor and its surrounding; it is generally longer than l but shorter than L .

Note: If a user wants to achieve a pre-determined GL, he must be very careful in selecting the procedure by which the sensor is anchored/attached/embedded. In case of continuously-fixed sensors, the fixing length must exceed the defined GL by a few tens of fibre diameter to avoid shear-lag problems at the edges. In the specific case of fracture or cracks within the GL of the sample, the final gauge length must be calculated then from the GL at fracture by subtracting from the latter the elastic portion of the elongation.



Sampling interval (przedział próbkowania)

It is time interval between two consecutive data points digitized by the sensing device, normally converted to distance given in metres, using user-defined parameters such as refractive index.

Note: It may depend on the distance range and other sensing device settings. The sampling interval is consequently a non-physical parameter and does not contain any information about the spatial resolution of the measurement system itself. It however contributes to the distance and location uncertainties.

Optical power dynamic range (optyczny zakres dynamiki)

It corresponds to the maximum cumulated one-way or two-ways loss (it must be indicated) in the optical link between the interrogator and the measurement point that makes possible a measurement with a specified performance.

Note: The measurement uncertainty, resolution and interrogator settings (pulse width, averaging time etc.) are interdependent and cannot be specified independently. In particular, loss budget can be improved at the expense of increased averaging time and/or uncertainty of measurement.

Warm-up time (czas wygrzewania)

It is the duration from power-on until the system performs in accordance with all specifications



Measuring time (czas pomiaru)

It is the required duration to obtain the result of a measurement (IOS VIM93 3.1) within specified uncertainty, spatial resolution and distance range.

Updating time (czas powtórzeń)

It is the duration between two subsequent results produced by the measuring system.

Limiting conditions (warunki graniczne)


They are extreme conditions that a measuring instrument is required to withstand without damage or without degradation of specified metrological characteristics when it is subsequently operated under its rated operating conditions (acc. to VIM 93 5.6)

4. Charakterystyki odpowiedzi

Kategoria ta daje relacje pomiędzy wyjściowymi wielkościami systemu pomiarowego a odpowiednimi wielkościami charakteryzującymi

mierzoną wielkość

- **Resolution**
- **Spatial resolution:**
 - Measuring spatial resolution
 - Detection spatial resolution
- **Full Scale**
- **Scale factor**
- **Responsivity**
- **Measurement dynamic range**
- **Linearity**
- **Cross-sensitivity**
- **Drift**




Resolution (rozdzielczość)


It represents the smallest change in the measurand, meaningfully detectable by the measurement system. The resolution is limited by either the instrument readout or precision (σ), whichever is bigger.

Spatial resolution (rozdzielczość przestrzenna) is specified for a fiber by the minimum distance between two step transitions of the measurand of at least 20 times its resolution.

Measuring spatial resolution (mierzona) is the minimum distance over which the system is able to indicate the value of the measurand within the specified uncertainty.

Detection spatial resolution (wykrywana) is the minimum distance that generate results that are within 10% of the measurand transition amplitude.

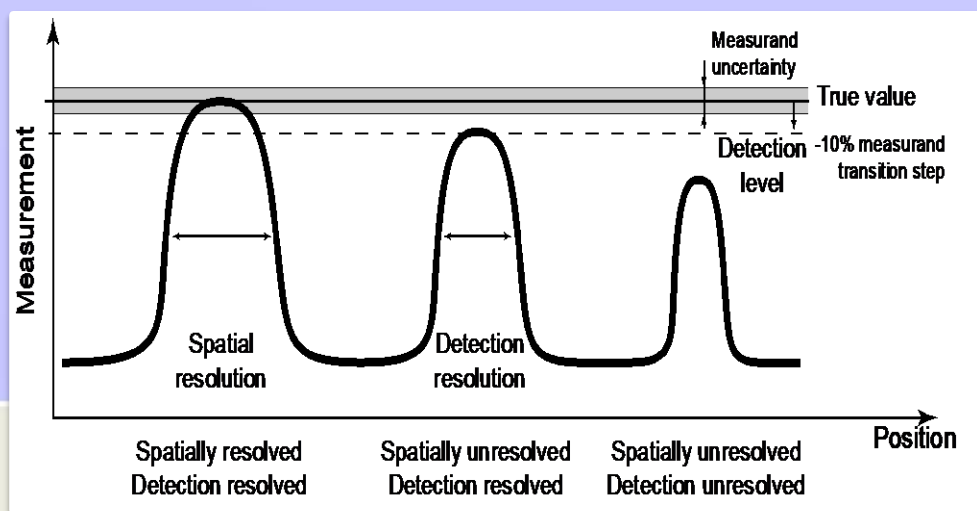

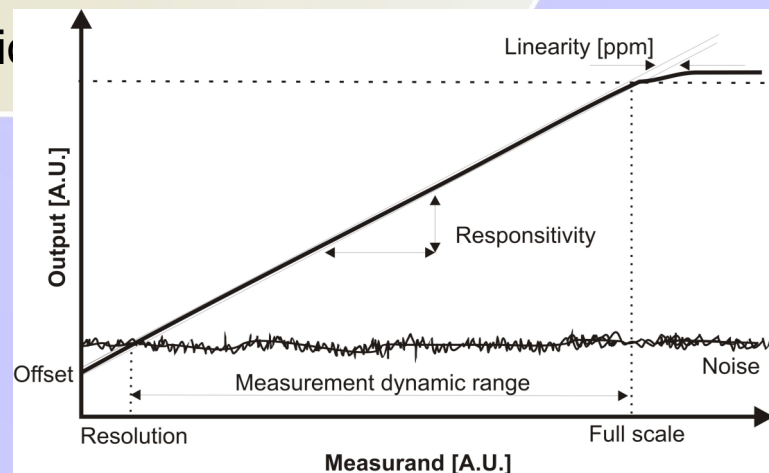

Full Scale (maksymum pomiaru)

It is the largest allowable value of the measurand.

Note: Full scale may be limited by several factors, e.g. onset of unacceptable non-linearities, mechanical issues, etc.

Scale factor (współczynnik skali)

It is the inverse of the ratio of a change in the stimulus to corresponding measured change. It may depend on the value of the stimulus.

Responsivity (czułość)

It expresses the change in the response (output signal) of a complete measurement system to the corresponding change in the stimulus (input signal).

Note: It may depend on the value of the stimulus, then the responsivity must be specified separately for each value. Normally, it is not dimensionless and cannot be expressed in percent.

Measurement dynamic range (zakres dynami pomiaru)

It is the ratio of the difference between the extremes of the measurement range (measurement span) to the resolution (the smallest detectable change), often expressed in dB.

Linearity (liniowość)

It is the tolerance to which a response characteristics of a measurement system approximates a straight line in the measurement dynamic range.

Note: Practically, deviation from linearity is usually expressed in ppm.

Drift (dryft)


It is a slow change of the metrological characteristics of the measurement system.

Note: It indicates a lack of stability due to environmental and operational affects, material effects (e. g. creep of adhesive) or storage conditions. Drift effect in a running measurement system causes a change of the output signal without variation of the input signal. Drift must be evaluated and indicates how often a measurement system needs recalibration. It must be distinguished between recalibration of devices and applied sensors (which is usually complicated or impossible). Concerning the scale factor, it can suffer from drift from zero or offset drift, or from a drift from the slope, or combinations of both. The estimated amount of the drift has to be expressed as an error estimate in the measurement result.

Cross-sensitivity (przesłuchy)

It is unwanted change of measurement result due to influence of physical factors other than the measurand.

Note: Typically, this is influence of temperature on mechanical sensors

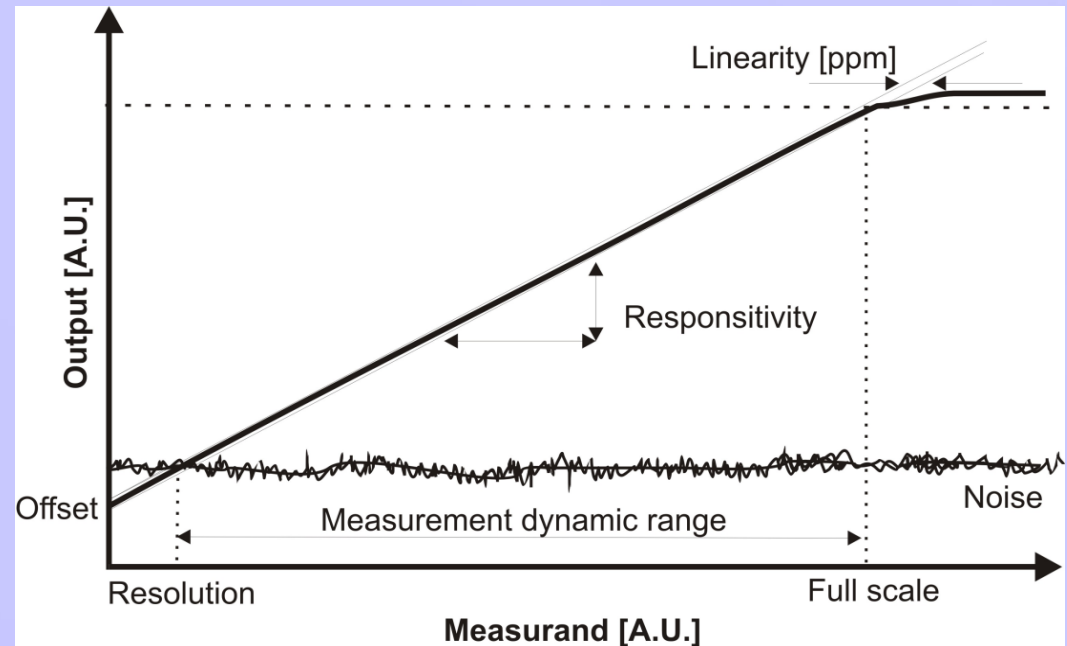

5. Wielkości o charakterze losowym

Wielkości te opisują nieskorelowane zaburzenia pomiaru wpływające na wiarygodność FOS

- **Accuracy:**
 - Location accuracy
 - Distance accuracy
- Precision
- Repeatability
- Reproducibility
- Uncertainty of measurement
- Bias
- Noise
- Stability

Accuracy (dokładność)

It qualitatively expresses the closeness of the measured value to the true or ideal ('master') value of the measurand. It represents the difference between the measured result and the true value and is affected by both bias and precision.


Note: Accuracy should not be confused with the term precision. Achieving high accuracy requires careful control of all factors influencing operation of measuring system, e. g. temperature, barometric pressure, etc.

Location accuracy (dokładność położenia) The displayed location minus the true location. This error is a function of the location.

Distance accuracy (dokładność odległości) The distance between two events provided by the measurement device minus the true distance.

Precision (precyzja)

It describes how repeatable a measurement result is. It is expressed by the estimated standard deviation of a specified series of measurements. (Sometimes precision is expressed as a multiple of the estimated standard deviation, e.g. 2σ). The smaller the dispersion of the measured values, the better the precision; precise measurement results need not to be necessarily accurate (e.g. due to bias). Therefore a result of a single measurement should be interpreted as drawn from an ensemble with the measured standard deviation.

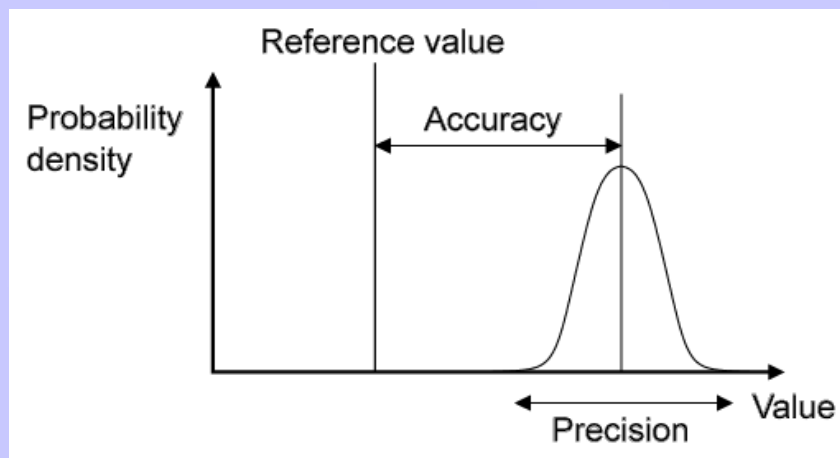

Repeatability (powtarzalność)

It is closeness of the agreement between the results of successive measurements of the same measurand carried out under the same conditions of measurement (acc. to VIM 94, 3.6)

Reproducibility (odtworzalność)

It is closeness of the agreement between the results of measurements of the same measurand carried out under changed conditions of measurement (acc. to VIM 94, 3.7)

Uncertainty of measurement (niepewność pomiarowa)

It means doubt about the validity of the estimate y for the measurand Y and reflects the lack of knowledge of the exact value Y . Uncertainty is expressed by a parameter $uc(y)$, associated with the result of measurement y that characterizes the dispersion of the values that can reasonably be attributed to the measurand. The parameter can be an estimated standard deviation (or a given multiple of it), or the half-width of an interval having a stated level of confidence.

Note: The evaluated dispersion $uc(y)$ must be additionally reported to the estimate y of the measurand Y ; it should preferably be stated in the ways proposed in the 'Guide to the Expression of Uncertainty in Measurement' (GUM), ISO 1995, chapter 7. The dispersion comprises uncertainties evaluated from the statistical distribution of the results of series of measurements, and also unknowable quantities due to possible errors. Uncertainty of relative measurements is usually significantly lower than the uncertainty defined above and rather depends on precision and drift.

Bias (odchyłka)

It is the difference between the measured result after averaging and the 'true' value. The true value can be obtained either by measuring a reference standard maintained by the national standard organizations or by using a traceable measuring instrument.

Noise (szum)

It is a random variation in the measurement result unrelated to the measurand. It primarily affects the precision of measurement.

Stability (stabilność)

It is the ability of a measurement system to maintain its metrological characteristics and meet other specifications over the intended service time.

6. Bezpieczeństwo optyczne

Zalecenia dotyczące bezpiecznego użytkowania przyrządów wyposażonych w źródła laserowe

Laser class

Safety of laser products. Part 1: Equipment classification and requirements (IEC 60825-1:2007) and Part 2: Safety of optical fibre communication systems (OFCS)

Note: power of the laser source is classified according to the accessible emission limit (AEL) which is - from the medical point of view - related to the Maximum permissible exposure (MPE)


Laser safety

EN 207, e. g. DIN EN 207:2008 - CE Marking and Laser Protective Eyewear

EN 208, e. g. BS EN 208:1999 - Personal eye-protection

Note: EN 207 is the European norm for laser safety eyewear and considered as a guide to understanding the standard for laser user

EN 208 applies to Visible lasers only (i. e. 400 - 700 nm wavelength range). Standards for laser use are nationalized.



7. Bibliografia

1. Habel, WR.: Reliable Use of Fiber Optic Sensors. In: Encyclopedia of Structural Health Monitoring. (Eds: Boller, C. et al.). John Wiley & Sons. 1. Edition January 2009. ISBN-10: 0-470-05822-6, ISBN-13: 978-0-470-05822-0
2. Tennyson R (Ed.). Installation, use and repair of fibre optic sensors. Design Manual ISIS-M02-00, Canada, spring 2001 and Civionics Specification. Design Manual No. 6, October 2004 (Chapter 2: Specifications for fibre optic sensors (FOS). ISIS Canada Research Network.
3. Dyer SD. Key metrology considerations for fiber Bragg grating sensors. Proc. of SPIE, vol. 5384 (2004) 181-189.
4. Fernandez AF, Gusarov A, Berghmans F, Kalli K, Polo V, Limberger H, Beukema M Nellen P. Round-robin for fiber Bragg grating metrology during COST270 action. Proc. of SPIE, vol. 5465 (2004), 210-216.
5. RILEM Technical Committee `Optical Fibre Sensors <http://www.rilem.net/tcDetails.php?tc=OFS>
6. The Association of German Engineers (VDI), Society of Experimental Stress Analysis (GESA). <http://www.vdi.de/strukturmonitoring>
7. IEC Final Draft 61757-1:1998: Fibre optic sensors – Part 1: Generic specification (Original language: German); SN EN 61757-1:1999-01 (Swiss Standard)
8. ISO/IEC Guide 98-3:2008: Uncertainty of measurement - Part 3: Guide to the expression of uncertainty in measurement. ISO, Geneva 2008, ISBN 92-67-10188-9.
9. International Vocabulary of Basic and General Terms in Metrology (VIM). Beuth Verlag GmbH Berlin Wien Zürich. 1994.